


APP CRS	Rwy Idg	4825
315°	TDZE	82
	Apt Elev	84

RNAV (GPS) Y RWY 31

SALINAS MUNI (SNS)

RNP APCH-GPS.	MALSR	MISSED APPROACH: Climb to 600 then dimbing left turn to 4800 direct MARNA and hold, continue dimb-in-hold to 4800.
⚠ Circling NA for Cats C and D northeast of Rwy 13 and north of Rwy 26. For inop ALS, increase LNAV Cat C/D visibility to RVR 5500.	⚠	

ATIS	NORCAL APP CON	SALINAS TOWER ★	GND CON	UNICOM
124.85	133.0 251.15	119.525 (CTAF) 0 239.3	121.7	123.0

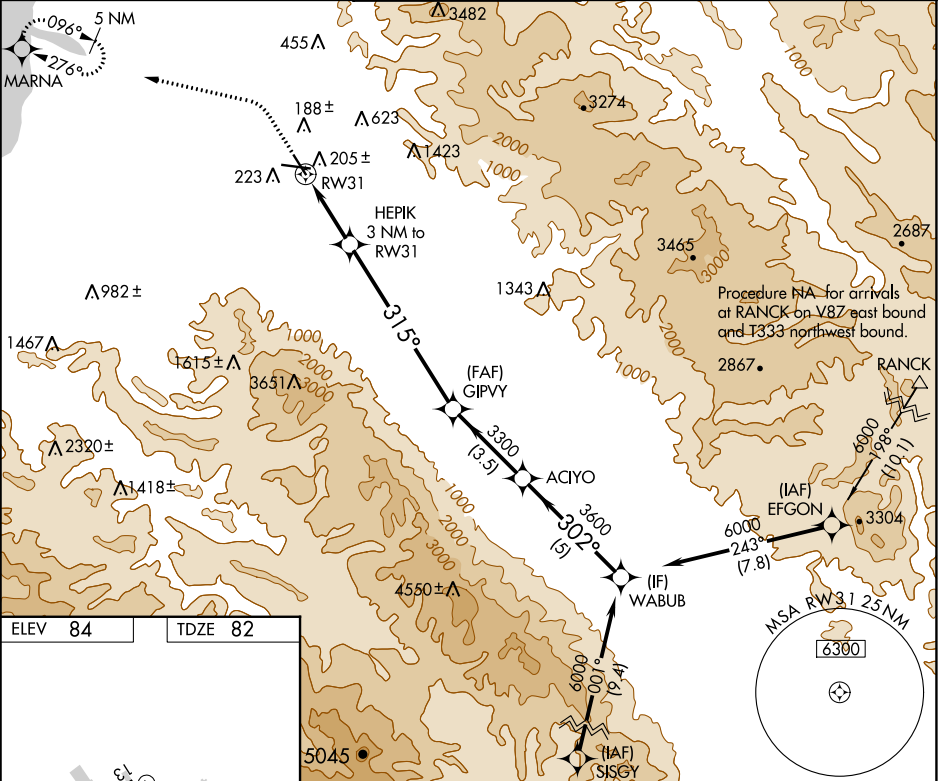

600	4800	MARN A	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 59).	WABUB
↑	↩	⬠	HEPIK 3 NM to RW31	ACIYO
			0.9 NM to RW31	GIPVY
			≤ 3.00° TCH 50	3300
			315°	3600
			0.9	2 NM
			7 NM	3.5 NM
			5 NM	
CATEGORY	A	B	C	D
LNAV MDA	440/24	358 (400-½)	440/30	358 (400-¾)
CIRCLING	540-1	456 (500-1)	780-2	1620-3
			696 (700-2)	1536 (1600-3)